

Ozone Resistant Pneumatic Equipment

(The use of pneumatic equipment in low ozone concentration environments)



SMC CORPORATION

Table of Contents

| | Pa | g |
|------|--|---|
| 1. I | Pneumatic Equipment Malfunctions Caused by Ozone | 1 |
| | Types of Malfunctions Caused by Ozone | |
| 2. I | Rubber Materials | 2 |
| | Ozone Concentration and the Time It Takes for Ozone to Generate Cracks (Deterioration) on Rubber | |
| | Basic Structure and Ozone Resistance | 3 |
| | Grease Coat Protection Effect | 4 |
| 3. 7 | The Deteriorating Effect of Ozone | 5 |
| | Causes and Progression Deterioration due to Ozone | |
| | Fluctuation of Ozone Concentration in Pneumatic Circuits | |
| 4. (| Ozone Resistance of Standard (HNBR) Products | 7 |
| | Setting | |
| | Endurance Test | |
| 5. (| Ozone | 8 |
| | What is Ozone? | |
| | Ozone Exposure Concentration and Its Physical Effects | |
| | Standard Ozone Concentration in Working Environments in Various Countries | |
| | Ozone Emitting Equipment and Devices | |
| 6. I | ist of Ozone Resistant Products 1: Standard (HNBR) | 9 |
| 7. I | ist of Ozone Resistant Non-HNBR Type Products 2: Series 801 | 0 |
| | Reference Data: Photochemical Oxidants | 1 |



1. Pneumatic Equipment Malfunctions Caused by Ozone

• Types of Malfunctions Caused by Ozone

Ozone can cause rubber materials (mostly NBR) used in pneumatic equipment to crack, and thereby lead to air leakage and malfunction.

Types of damage and malfunctions

| Devices | Damaged parts | Results | |
|------------------------|---|--|--|
| Regulator | Diaphragm Photo 1 | Constant air leakage from bleed hole Unable to adjust pressure | |
| | Main valve seat | Constant air leakage from bleed hole Unable to adjust pressure | |
| Speed control valve | Valve seat rubber for check valve Check valve seal • Unable to adjust pressure | | |
| Solenoid valve | Main valve seal Photo 3 | Air leakage, Malfunction | |
| | Gasket • Air leakage, Malfunction | | |
| Cylinder (Actuator) | Seals are coated with a lubricant that has a shielding effect from ozone. Damage does not occur. For cylinders lubricated by a compressed air system lubricator, the oil film that is provided to components in this way is equivalent to a grease coat in its protective effects. Even with non-lube type cylinders, grease protects seals from being damaged. | | |
| | (Refer to Grease Coat Protection Effect on page 4.) | | |

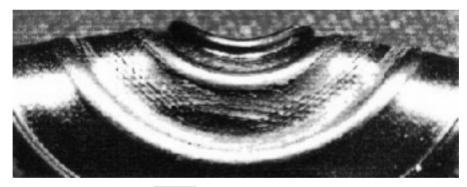


Photo 1 Cracking of diaphragm



Photo 2 Cracking of check valve seal

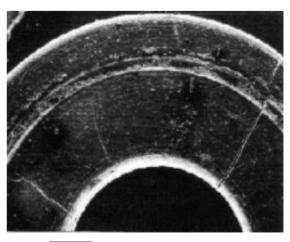


Photo 3 Cracking of main valve seal

Ozone Concentration and the Time It Takes for Ozone to Generate Cracks (Deterioration) on Rubber

In most cases, there is a clear-cut relationship between ozone concentration (C) and the time it takes for ozone to generate cracks $(\tau)^*$.

$$\tau \cdot C^n = Const.$$

τ: Time it takes for ozone to generate cracks (h)

C: Ozone concentration (ppm)

n: Constant that varies depending on the rubber material

Take the logarithm and rearrange the above equation as follows:

$$\begin{aligned} & log\tau = K - n \ logC \\ & \text{K: Constant} \end{aligned}$$


*YU.S Zuev and S.I. Pravednikova "Rubber Chemistry and Technology" (1962) Page 411 to 420

Linear relationships were obtained when plotting the logarithms of the experiments SMC conducted on ozone concentration and the time it takes for ozone to generate cracks. What became evident is that as ozone concentration increases, the time it takes for ozone to generate cracks decreases. These tests were conducted under conditions that are much more

severe than those of a normal operating environment, and were likewise evaluated more stringently. The solid lines in the graph indicate actual measurements gathered during the tests, and the dotted lines are estimated values obtained from calculations. Changes in ozone concentration greatly affect the time it takes for ozone to generate cracks.

Ozone concentration and its direct relation to the appearance of cracks (time factor) (NBR)

JIS K6259: Testing Methods of Resistance to Ozone Cracking for Vulcanized Rubber

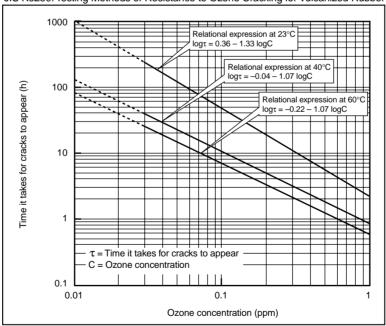

<Test conditions>

Specimen: I-shaped dumbbell

Tensile strain: 20 ±2%

Evaluation: Cracking detection using a magnified 50x metallurgical microscope



Basic Structure and Ozone Resistance

Molecular structure


Ozone resistance of NBR and HNBR varies depending on its structure.

Basic molecular structures

| Rubber type | Basic molecular structure |
|--|--|
| NBR (acrylonitrile-butadiene rubber) | (-CH2-CH=CH-CH2-)x — (-CH2-CH-)y CN |
| HNBR (hydrogenated nitrile butadiene rubber) | (-CH2-CH2-CH2-CH2-)x — (-CH2-CH-)y CN |

Double bond

Deterioration caused by ozone occurs when ozone acts on the NBR double bond to break the rubber molecules apart.

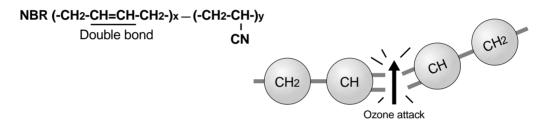

On the other hand, HNBR's basic structure, which is becoming more and more standard, eliminates the double bond of NBR by adding hydrogen. Although a minute amount of double bond remains in the structure of HNBR to allow it to maintain its physicality as a rubber, its structure has an excellent ozone resistance.

Ozone resistance

An experiment was performed under test conditions conforming to JIS K6259, and using air containing 1ppm of ozone. The test conditions (ozone concentration, temperature, and tensile strain) were much more severe than those in a normal operating environment;

therefore, cracks were evident in NBR in just 1 to 25 hours of exposure to ozonic air. On the other hand, when the same stringent conditions were applied to HNBR, cracks did not appear even after 1000 hours of exposure.

Ozone resistance

| Rubber type | Time it takes for ozone to generate cracks |
|-------------|--|
| NBR |)1 to 25hrs. |
| HNBR | 1000hrs. or more |

<Test conditions>

Ozone concentration: 1ppm Specimen: I-shaped dumbbell Tensile strain: 20 ±2% Testing temperature: 40 ±1°C



Grease Coat Protection Effect

A coating of grease or other lubricants is an effective way to shield NBR parts from ozone attack. When the protective effects of grease were tested and measured, it was found that cracks began to appear after 1 to 25 hours of ozone exposure on NBR components that had not been given a grease coating. On the other hand, cracks did not appear on the components that had received a grease coating, even after more than 1000 hours of ozone exposure. The reasons giv-

en for these results are the physical shielding effects of grease, as well as its chemical effects as it reacts to ozone and accelerates its decomposition.

Therefore, no ozone generated cracks were found on components whose seals or seal surfaces are normally treated with a coat of grease (lubricant), e.g., cylinders, rotary actuators, or quick disconnect release couplings (One-touch fittings).

Grease coat protection effect

JIS K6259: Testing Methods of Resistance to Ozone Cracking for Vulcanized Rubber

| | <u> </u> |
|-------------------|--|
| | Time it takes for ozone to generate cracks |
| Uncoated NBR |)1 to 25hrs. |
| Grease coated NBR | 1000hrs. or more |

<Test conditions>

Ozone concentration: 1ppm Specimen: I-shaped dumbbell Tensile strain: 20 ±2% Testing temperature: 40 ±1°C Amount of grease applied: 6.3mg/cm²



Causes and Progression of Deterioration due to Ozone

How ozone gets into a pneumatic system

From measurements taken to date, we know with certainty that the concentration of ozone in the air that a pneumatic system compressor takes in is at most 0.1ppm at a standard atmospheric pressure rating. Factory machinery and equipment are primary sources of ozone. Nevertheless, ozone can also be found in nature along with photochemical oxidants. (Refer to page 11 for details.)

When compressed air containing ozone (possibly generated from other machinery and equipment present in a plant) enters a pneumatic system, it adversely affects the system's rubber components. Besides the more commonly recognized sources of ozone described under "Ozone Emitting Equipment and Devices" on page 8, an air compressor motor that

is not maintained and serviced at the proper scheduled intervals can also become a source of ozone emissions.

Traditionally, lube type reciprocating compressors have been widely used in pneumatic systems. Through the use of these ozone-efficient compressors, the amount of ozone in a pneumatic system could be reduced, and its effects in lines nullified, by the heat produced during compression and by the action of draining condensate out of the system. In recent years, however, the widespread use of non-lube type turbocompressors and displacement compressors (dry rotary type) has decreased the chances for ozone depletion in lines.

Fluctuations to Ozone Concentration in Pneumatic Circuits

An ozonizer was used to prepare air with ozone concentration rates of 1.1ppm and 0.1ppm. The air was introduced into the lines in the system through the compressor's intake port, and measurements were taken of changes in the concentration of ozone after the air passed through the various filters, dryers, and regulators. Since it is extremely difficult to measure the

ozone concentration in pressurized air while it is in lines, samplings of pressurized air were taken from certain points in the pneumatic circuit (see ① to ⑥ below) and the ozone concentration was measured immediately, using an ultraviolet absorbent densitometer (EG-2001F made by EBARA JITSUGYO CO., LTD).

Pneumatic circuitry at an atmospheric dew point of 10°C (Circuit not passing through refrigerated air dryer)

* The bold line is the testing circuit.

Pneumatic circuitry at an atmospheric dew point of -17°C (Circuit passing through refrigerated air dryer)

* The bold line is the testing circuit.



The residual ozone ratio in pneumatic lines


In the lines of lube-type reciprocating compressor, with intake air containing a concentration of 1.1ppm of ozone, the ozone is phased out as follows:

- Some 95% or more of the ozone is eliminated as air passes through the main line filter (AFF) — as measured at point ① which is just downstream of the AFF in the circuit.
- Most of the remainder is eliminated as air passes through the refrigerated air dryer (IDF) and mist separator (AM) as measured at point ②, just downstream of these components in the circuit.


Ozone depletion is much slower in a non-lube scroll type compressor than in a lube type reciprocating compressor. At the same ozone concentration of 1.1ppm, approximately 25% of the ozone still remains in the circuit as measured at point 2 — downstream of the mist separator (AM) — at an atmospheric dew point of 10°C. When the atmospheric dew point is -17°C, approximately 45% of the ozone still remains. Furthermore, with an ozone concentration as low as 0.1ppm in intake air, fast ozone depletion is evident just until after air passes through the main line filter (AFF) — as measured at point (1) in the circuit. After that point, however, ozone depletion is as slow as if the concentration were greater i.e., as if it were an original concentration of 1.1ppm. Even after the air has passed through the micromist separator (AMD), a very small residual quantity can still be found in lines at point 4, just downstream.


These observations illustrate that the use of so-called "oil-free" air sources and compressed air at low dew points make it difficult to eliminate ozone in pneumatic lines.

The residual ozone ratio in the lines of lube type reciprocating compressor

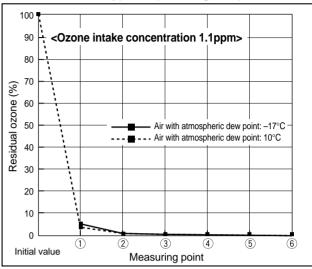

Changes in the residual ozone ratio in the lines of non-lube scroll type compressor

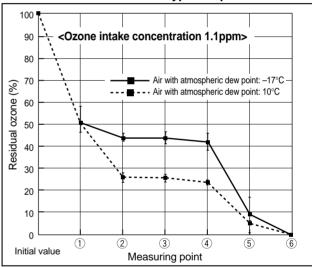

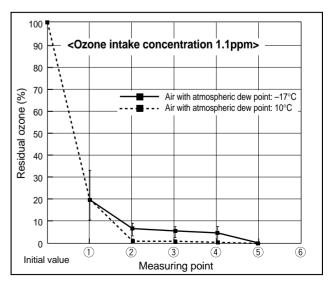



4. Ozone Resistance of Standard (HNBR) Products

Setting

Even when ozone is present in compressed air, its concentration is depleted as it travels through the lines in a pneumatic circuit. (Refer to "Fluctuations in the Concentration of Ozone within a Pneumatic System" on page 5.) However, the ratio of ozone depletion, and

the harm that residual ozone can cause to pneumatic circuitry, varies according to the equipment and components that are implemented in the particular pneumatic circuit. NBR, for example, is a material that can suffer deterioration caused by residual ozone.

Evaluation criteria for ozone resistance

SMC's evaluation criteria for ozone resistance in its products can be defined as follows:

Products meeting a 5-year (or 43,800 hours) resistance rating (or equivalent) under working conditions that include 40°C ambient and fluid temperatures and an ozone concentration of 0.03ppm in 0.5MPa compressed air. These standards assume the normal concentration of ozone usually found in the atmosphere, and the ozone depletion that takes place


in a pneumatic circuit, but allow for wide tolerance margins in product design.

Please refer to the "List of Ozone Resistant Products 1: Standard (HNBR)" on page 9 to familiarize yourself with standard products using HNBR.

For non-HNBR devices that nevertheless afford superior ozone protection, please refer to the "List of Ozone Resistant Products 2: Series 80-" on page 10.

Endurance Test

An ozonizer was used in a pneumatic circuit to prepare air to an ozone concentration of 1ppm. The test specimens (system components made from HNBR and NBR) were operated using this ozoneladen compressed air, and the endurance of each type of component/material was measured and compared.

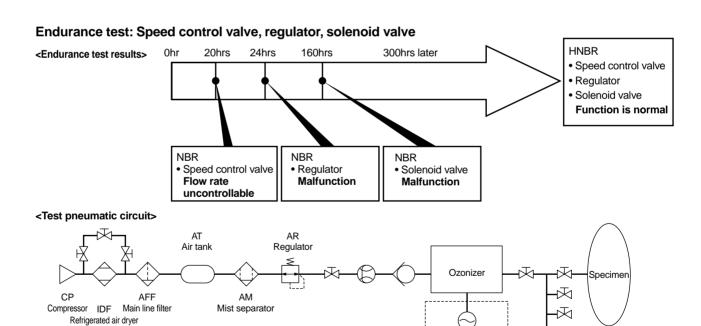

<Test conditions>

| Models | | Ozone resistance evaluation | | |
|----------------|----------------------------------|-----------------------------|-----------------------------|---------|
| | | Conditions | Operating frequency | |
| Speed control | Series AS-F | NBR | Ozone concentration: | ON |
| valve | AS1000, 1400 AS12⊡0 to AS42⊡0 | HNBR | 1ppm Inlet pressure: | 0.5 sec |
| Damilatan | AR1000 to 6000 | NBR | 0.7MPa | OFF |
| Regulator | AW1000 to 4000 | HNBR | Set pressure: | 0.5 sec |
| Calamaidumhua | VO400411.5 | NBR | O.5MPa Ambient temperature: | 1Hz |
| Solenoid valve | VQ1201H-5 | HNBR | 23°C | 1112 |

Line: Polyurethane tube (TU0604); Fitting: Quick disconnect release coupling (One-touch fitting KQ2)

Control panel



What is Ozone?

Ozone is an allotrope of oxygen, and small quantities of it are present in air. It is formed by electrical discharges in dry gaseous oxygen or air. It is also formed through the heating of fluorine, water, oxygen, and through the exposure of air to ultraviolet irradiation or X-rays. A light-blue gas with a distinctive odor, it is highly oxidative and is used for sterilization, bleaching, and oxidation purposes.

Since ozone is highly poisonous, large concentrations

of it can affect the respiratory system. Even a small quantity of this gas can be toxic if inhaled for long periods.

Normal concentration of ozone in the atmosphere is between 0 and 0.03ppm, but when ozone emissions from the "Ozone Emitting Equipment and Devices" table below are added to the normal atmospheric level, the concentration could reach up to 0.1ppm.

Ozone Exposure Concentration and Its Physical Effects

| Ozone (ppm) | Effects |
|--------------|--|
| 0.01 to 0.02 | Odor is somewhat detectable by smell (but after a while, it becomes indistinguishable). |
| 0.1 | Odor is clearly detectable by smell. Nose and throat can feel an irritating sensation. |
| 0.2 to 0.6 | Impairs vision after 3 to 6 hours of exposure |
| 0.5 | Definite irritating sensation can be felt in upper respiratory passage. |
| 1 to 2 | Headache, chest pain, dryness in upper respiratory passage, and coughing after 2 hours of exposure. Repeated exposure can cause chronic poisoning. |

Reference: Hidetoshi Sugimitsu, Ozone no Kiso to Oyo ("Basis and Application of Ozone") Korin Co., Inc., (1996)

• Standard Ozone Concentration in Working Environments in Various Countries

| Country | Ozone concentration (ppm) |
|-----------|---------------------------|
| Australia | 0.1 |
| Belgium | 0.1* |
| Denmark | 0.1 |
| Finland | 0.1 |
| France | 0.1 |
| Germany | 0.1 |

TWA — Time Weighted Average: Level of ozone that is considered non-hazardous to almost all workers if the time average of ozone exposure concentration is below the indicated value. This condition applies when workers are engaged in physically light labor for 8 hours a day, 40 hours a week.

| Country | Ozone concentration (ppm) |
|---------------|---------------------------|
| Japan | 0.1 |
| Sweden | 0.1 |
| Switzerland | 0.1 |
| Great Britain | 0.1 |
| United States | 0.1* |
| Russia | 0.1 |

*STEL — Short Time Exposure Limit: Applied to toxic substances that mainly affect living organisms after short time exposure. For our purposes, it refers to a level of ozone that is considered non-hazardous to almost all workers if the time average value for 15 minutes is below the indicated value.

Reference: ILO OCCUPATIONAL SAFETY AND HEALTH SERIES NO. 37 (THIRD EDITION 1991)

Ozone Emitting Equipment and Devices

Because ozone is easily formed by electric discharges or light energy, many ozone emitting devices may be found in the workplace or in the home.

| Devices | Ozone formation | Ozone concentration | Environment |
|---|--|---|---|
| Air purifier | Corona discharge | A few ppm | Office environment, Household environment |
| Sterilizer | Ultraviolet light | A few ppm | Office environment, Household environment |
| Ultraviolet curing device | Ultraviolet light | A few dozen ppm | Industrial environment |
| Copy machine, Printer | Corona discharge | Up to a few dozen ppm | Office environment, Household environment |
| Welding machine | Ultraviolet rays, Arc discharge | A few ppm | Industrial environment |
| Static removal equipment | Electrical discharge | A few dozen ppm | Industrial environment, Office environment |
| Surface finishing machine | Electrical discharge, Ozonizer | More than a hundred and less than 100,000 ppm | Industrial environment |
| Electron beam, X-ray irradiation machine | Electron beam, X-rays | More than a hundred and less than 10,000 ppm | Industrial environment |
| High voltage electric generating plant | Electrical discharge | Up to a few dozen ppm | Industrial environment |
| Semiconductor dry cleaner | Ultraviolet light, Electrical discharge | More than a hundred and less than 100,000 ppm | Industrial environment |
| Electric dust collector | Corona discharge | A few ppm | Industrial environment |

Reference: Shigeyuki Ota and Hironori Shimizu (Eds) Ozone Riyo no Riron to Jissai ("Theory and Practice of Ozone Use") Riaraizu Co., Inc., (1989)



List of Ozone Resistant Products 1: Standard (HNBR)

| | Description | Se | ries |
|-------------------------|--|------------|--|
| Directional | 4-, 5-port solenoid valve | VQ | 0000 |
| control valves | • | | 1000 |
| | | | 2000 |
| | | | 4000 |
| | | | 5000 |
| | | VQZ | 1000 |
| | | | 2000 |
| | | | 3000 |
| | | SQ | 1000 |
| | | | 2000 |
| | | VQD | 1000 |
| | | SY | 3000 |
| | | | 5000 |
| | | | 7000 |
| | | SYJ | 3000 |
| | | | 5000 |
| | | | 7000 |
| | | SX | 3000 |
| | | | 5000 |
| | | | 7000 |
| | 3-port solenoid valve | VQ | 20, 30 |
| | (2) | VQ | 100 |
| | | VQZ | 100 |
| | | | 200 |
| | | | 300 |
| | | SY | 100 |
| | | | 300 |
| | | | 500 |
| | | SYJ | 300 |
| | | | 500 |
| D | <u> </u> | 4 D | 700 |
| Pressure control valves | Regulator | AR | 1000 |
| vaives | | | 2000 |
| | | | 2500 |
| | | | 3000 |
| | | | 4000 |
| | | | 4000-06 5000 |
| | | | 6000 |
| | Filter regulator | AW | 1000 |
| | Timor regulator | 7.00 | 2000 |
| | | | 3000 |
| | | | 4000 |
| | | | 4000-06 |
| | Regulator with residual pressure | AR | 2550 |
| | exhaust | | 3050 |
| | | | 4050 |
| | | | 4050-06 |
| | Filter regulator with residual | AW | 3050 |
| | pressure exhaust | | 4050 |
| | | | 4050-06 |
| | Regulator with reverse flow | AR | 2060 |
| | check valve | | 2560 |
| | | | 3060 |
| | | | 4060 |
| | | | 4060-06 |
| | | | 5060 |
| | | | 6060 |
| | Pressure regulator | AR | 425 |
| | with internal silet | | 625 |
| | with internal pilot | | |
| | with internal pilot | | 825 |
| | | | 925 |
| | Direct operated precision regulator | ARP | 925 3000 |
| | | ARP ARJ | 925 3000 210 |
| | Direct operated precision regulator Miniature regulator | ARJ | 925 3000 210 1020 |
| | Direct operated precision regulator | | 925 3000 210 1020 3□00 |
| | Direct operated precision regulator Miniature regulator | ARJ | 925 3000 210 1020 3□00 4□00 |
| | Direct operated precision regulator Miniature regulator | ARJ | 925 3000 210 1020 3□00 |

| Description | | Series | | |
|---------------------|--------------------------|--------|--|--|
| Pressure control | Manifold regulator | ARM | 1000 | |
| valves | | | 2000 | |
| | | | 2500 | |
| | . | | 3000 | |
| | Mist separator regulator | AWM | 2000 | |
| | | | 3000 | |
| | Micro mist separator | AWD | 2000 | |
| | regulator | AVVD | 3000 | |
| | regulator | | 4000 | |
| Flow control valves | Speed controller | AS | 1000-M3 1200-M3 1400-M3 1000-M5 12□0-M3 (U10, 32) 12□0-M5-F 22□0-□01 22□0-01-F 22□0-□02 22□0-02-F 32□0-□03 (02) 32□0-03-F (02) | |
| | Speed controller | ASD | 42\ 0-\ 04\ 42\ 0-\ 04-F\ 12\ 1F\ -M3\ 13\ 1F\ -M5\ (U10, 32)\ 13\ 1F\ -M5\ (U10, 32)\ 22\ 1F\ -\ 01\ 23\ 1F\ -\ 01\ 2211F\ -01\ 2211F\ -01\ 23\ 1F\ -\ 03\ (02)\ 33\ 1F\ -\ 03\ (02)\ 42\ 1F\ -\ 04\ 43\ 1F\ -\ 04\ 1000F\ 2050F\ 3000F\ 4000F\ 2050F\ 3000F\ 4001F\ 2051F\ 3001F\ 4001F\ 230F\ 330F\ 430F\ 530F\ 630F\ 630F\ | |
| Vacuum | Vacuum ejector | ZM | 5501 | |
| products | | ZZM | | |
| | | | | |



List of Ozone Resistant Non-HNBR type Products 2: Series 80-

| Description | | Series | Note |
|---|--|------------------------------------|-------------------------|
| | 4, 5-port solenoid valve | 80-VF3000 | |
| ,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,, | | 80-VF5000 | |
| | | 80-VK3000 | |
| | 3-port solenoid valve | 80-VP300 | |
| Directional control | | 80-VP500 | |
| valves | | 80-VP700 | |
| | | 80-VJ100 | |
| | | 80-VT307 | |
| | | 80-VT317 | |
| | | 80-VK300 | |
| | | 80-VKF300 | |
| | Mechanical valve | 80-VM130-01-00 | |
| | | 80-VM230-02-00 | |
| | | 80-VM430-01-00 80-VZM450-01-00 | |
| | | 80-VZM450-01-00 80-VZM550-01-00 | |
| | | 80-VFM350-02-00 | |
| | 2 part residual pressure release value | 80-VHS400 | |
| | 3-port residual pressure release valve | 80-VHS500 | |
| | 3-port residual pressure release valve | 80-VHS2500 | |
| | with keyhole | 80-VHS3500 | |
| | | 80-VHS4500 | |
| | 2 part racidual proceura ralagge valva | 80-VHS2000 | |
| | 3-port residual pressure release valve | 80-VHS3000 | |
| | | 80-VHS4000 | |
| Power valves | Regulator valve | 80-VEX120□- | Air operated type only |
| | | 80-VEX130□- | |
| | | 80-VEX150□- | |
| | | 80-VEX170□- | |
| | Precision regulator valve | VEX1A33B | Standard: Fluoro rubber |
| | | VEX1B33B | |
| | | 80-VEX1233- | |
| | | 80-VEX1533- | |
| | O manification and an | 80-VEX1733- | |
| | 3-position valve | 80-VEX350□ | Air operated type only |
| Pressure control valves | Pilot operated pressure regulator | 80-AR435 to 935 | |
| | Clean room regulator | SRH3000 | |
| | | SRH4000 | |
| | Precision regulator valve | 80-IR1000 | |
| | | 80-IR2000 | |
| | | 80-IR3000 | |
| | Electro-pneumatic regulator | 80-ITV0000 | |
| | | 80-ITV1000 | |
| | Electronic vacuum regulator | 80-ITV2000 80-ITV209□ | |
| Flames | 9 | | |
| Flow conrol valves | Check valve Quick exhaust valve | 80-AK 80-AQ | |
| Vacuum products | Vacuum (ejector system) | 80-ZX1□ | |




Reference Data

Photochemical Oxidants


"Photochemical oxidants" is a general term used to refer to a type of secondary pollutants that in their original (primary state) are mainly composed of industrial and automobile emissions of nitrogen oxide (NOx) and hydrocarbons (HC). When these contaminants are exposed to sunlight irradiation, they experience a photochemical reaction that changes their composition into photochemical oxidants. The adverse environmental effects of their altered secondary nature are equivalent to a 60 to 90% concentration of ozone.

According to a Tokyo Environmental White Paper, although the maximum concentration of photochemical oxidants recorded during daytime hours (5 a.m to 8 p.m.) in 1999 was 0.173ppm, the average concentration recorded for that years was 0.026ppm. Therefore, it seems unlikely that there would be enough concentration of photochemical oxidants to cause adverse effects on pneumatic equipment.

Oxidant concentration in Tokyo, 1999

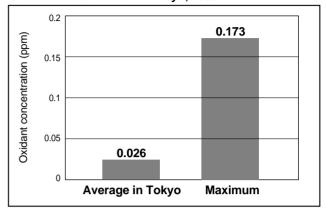

Photochemical smog emergency alert (Tokyo)

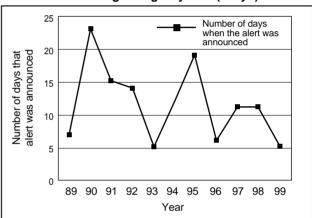


Excerpted from the web page of Tokyo Environmental White Paper 2000





SMC'S GLOBAL MANUFACTURING, DISTRIBUTION AND SERVICE NETWORK

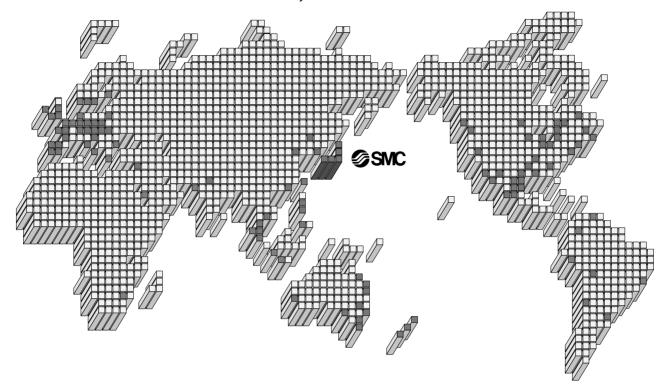

EUROPE

AUSTRIA

SMC Pneumatik GmbH

CZECH

SMC Industrial Automation CZ s.r.o.

DENMARK

SMC Pneumatik A/S

FINLAND

SMC Pneumatics Finland Oy

FRANCE

SMC Pneumatique SA

GERMANY

SMC Pneumatik GmbH

HUNGARY

SMC Hungary Ipari Automatizálási Kft.

IRELAND

SMC Pneumatics (Ireland) Ltd.

ITALY

SMC Italia S.p.A.

NETHERLANDS

SMC Pnuematics BV.

NORWAY

SMC Pneumatics Norway A/S

SMC Industrial Automation Polska Sp.z.o.o.

ROMANIA

SMC Romania s.r.l.

RUSSIA

SMC Pneumatik LLC.

SLOVAKIA

SMC Priemyselná automatizáciá, s.r.o.

EUROPE

SI OVENIA

SMC Industrijska Avtomatika d.o.o.

SPAIN/PORTUGAL

SMC España, S.A.

SWEDEN

SMC Pneumatics Sweden AB

SWITZERLAND

SMC Pneumatik AG.

SMC Pneumatics (U.K.) Ltd.

ASIA

CHINA

SMC (China) Co., Ltd.

HONG KONG

SMC Pneumatics (Hong Kong) Ltd.

SMC Pneumatics (India) Pvt. Ltd.

MALAYSIA

SMC Malaysia (S.E.A.) Sdn. Bhd.

PHILIPPINES

SMC Pneumatics (Philippines), Inc.

SMC Pneumatics (S.E.A.) Pte. Ltd.

SOUTH KOREA

SMC Pneumatics Korea Co., Ltd.

SMC Pneumatics (Taiwan) Co., Ltd.

THAILAND

SMC Thailand Ltd.

NORTH AMERICA

CANADA

SMC Pneumatics (Canada) Ltd.

MEXICO

SMC Corporation (Mexico) S.A. de C.V.

SMC Corporation of America

SOUTH AMERICA

ARGENTINA

SMC Argentina S.A.

BOLIVIA

SMC Pneumatics Bolivia S.R.L.

BRAZIL

SMC Pneumaticos Do Brazil Ltda.

CHILE

SMC Pneumatics (Chile) S.A.

VENEZUELA

SMC Neumatica Venezuela S.A.

OCEANIA -

AUSTRALIA

SMC Pneumatics (Australia) Pty. Ltd.

NEW ZEALAND

SMC Pneumatics (N.Z.) Ltd.

SMC CORPORATION

1-16-4 Shimbashi, Minato-ku, Tokyo 105-0004, JAPAN Tel: 03-3502-2740 Fax: 03-3508-2480 URL http://www.smcworld.com © 2001 SMC CORPORATION All Rights Reserved

1st printing October, 2001

D-SMC.L.A. P-80 (YG)